

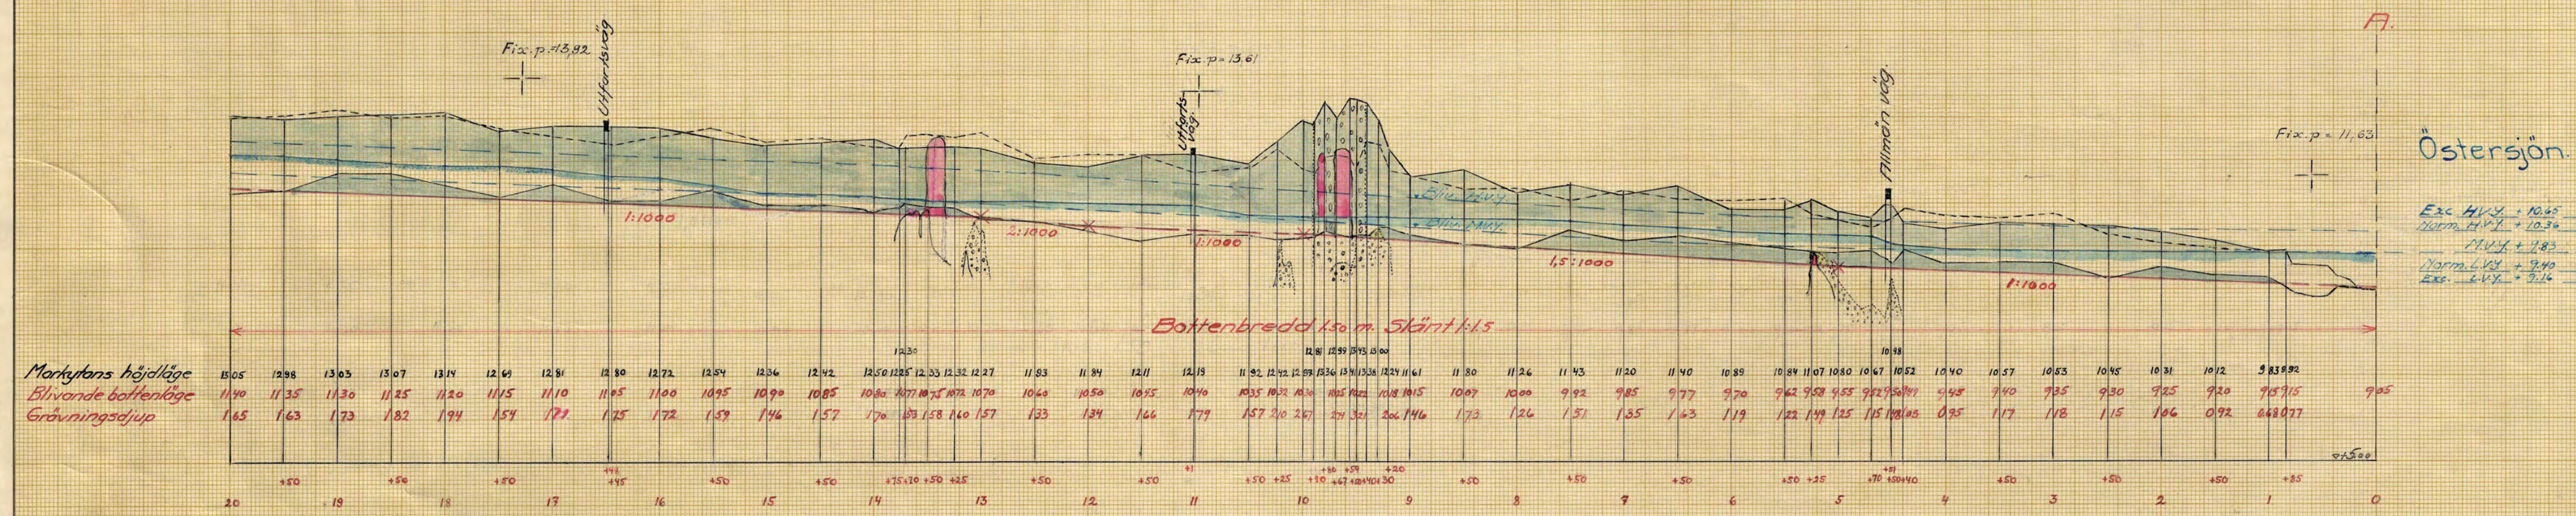
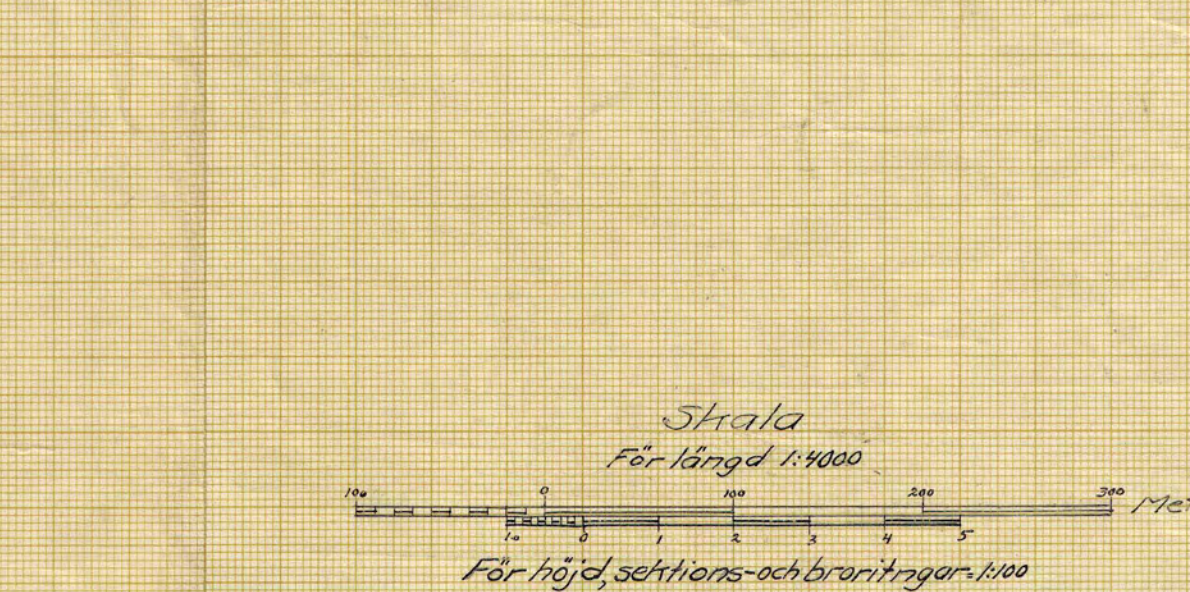
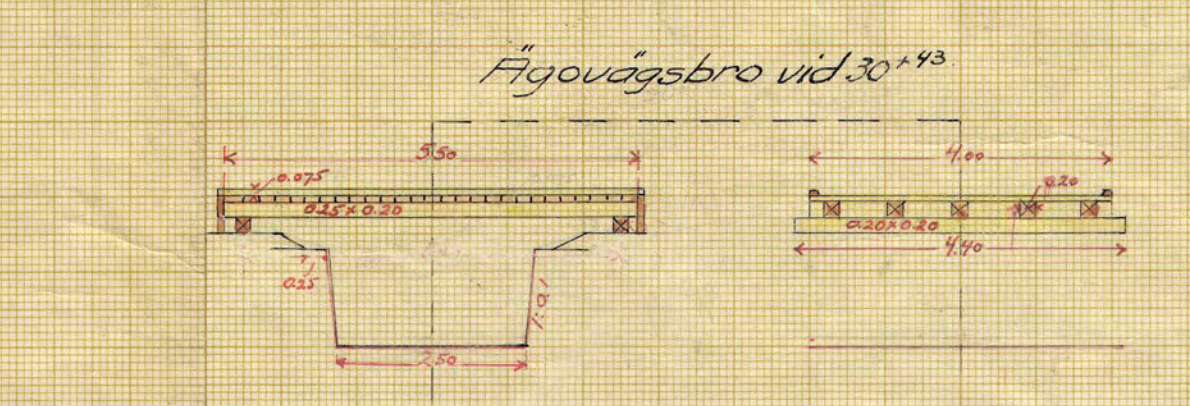


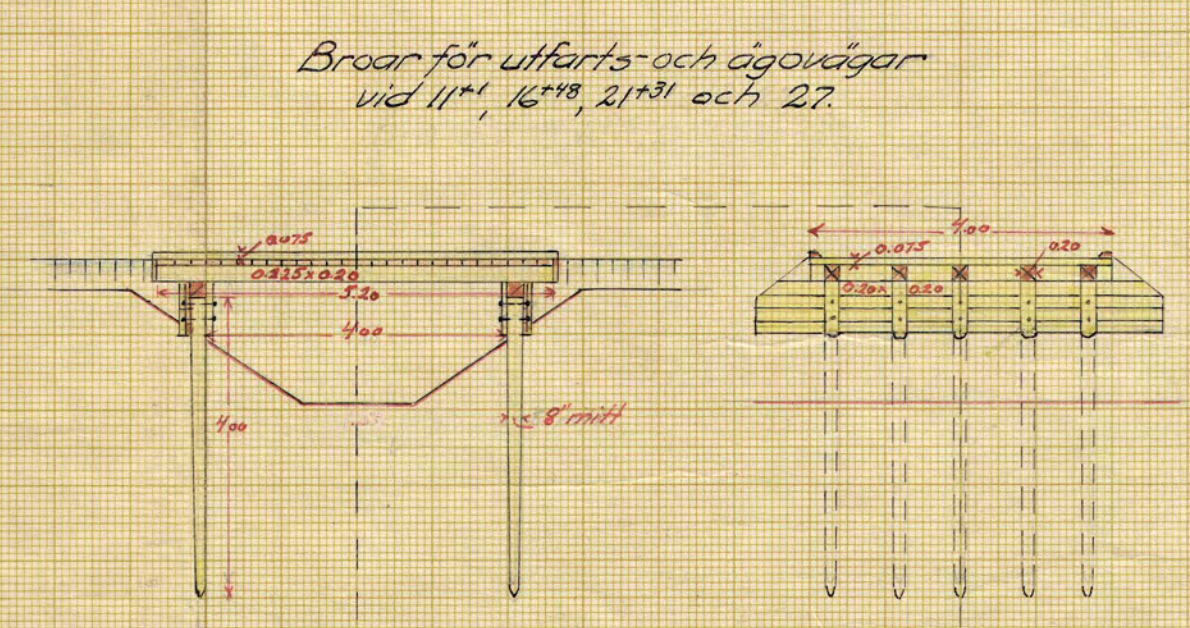

Markytans höjdläge	15+05	12+98	13+03	13+07	13+14	12+61	12+91	12+80	12+72	12+64	12+52	12+50	12+55	12+53	12+32	12+27	11+83	11+84	12+11	12+19	11+92	12+22	12+29	12+34	12+31	12+34	11+61	11+80	11+26	11+43	11+50	11+40	10+89	10+84	11+07	10+80	10+67	10+52	10+40	10+57	10+53	10+45	10+31	10+72	9+83	9+92
Blivande bottenläge	11+40	11+35	11+30	11+25	11+20	11+15	11+10	11+05	11+00	10+95	10+90	10+85	10+80	10+77	10+75	10+70	10+60	10+50	10+55	10+40	10+35	10+32	10+34	10+35	10+38	10+45	10+67	10+80	10+92	9+85	9+77	9+70	9+62	9+58	9+55	9+52	9+40	9+35	9+30	9+25	9+20	9+15	9+05			
Grövningsdjup	1+65	1+63	1+73	1+82	1+94	1+54	1+72	1+57	1+46	1+57	1+70	1+65	1+58	1+60	1+57	1+33	1+34	1+66	1+79	1+57	1+50	1+50	1+50	1+50	1+50	1+72	1+26	1+31	1+35	1+43	1+19	1+22	1+49	1+25	1+5	1+10	0+85	1+17	1+18	1+15	1+06	0+92	0+88	0+77		
		+50		+50		+80	+98 +95	+50		+50	+35 +30	+50	+25	+50	+25	+50	+50		+50	+25	+10 +67	+30 +29	+20 +10	+50	+50	+50	+50	+50	+50	+50	+50	+25	+10 +40	+40	+50	+50	+50	+50	+50	+50	+50	+50	+50	+50		
	20	19		18		17		16		15		14		13		12		11		10		9		8		7		6		5		4		3		2		1		0						

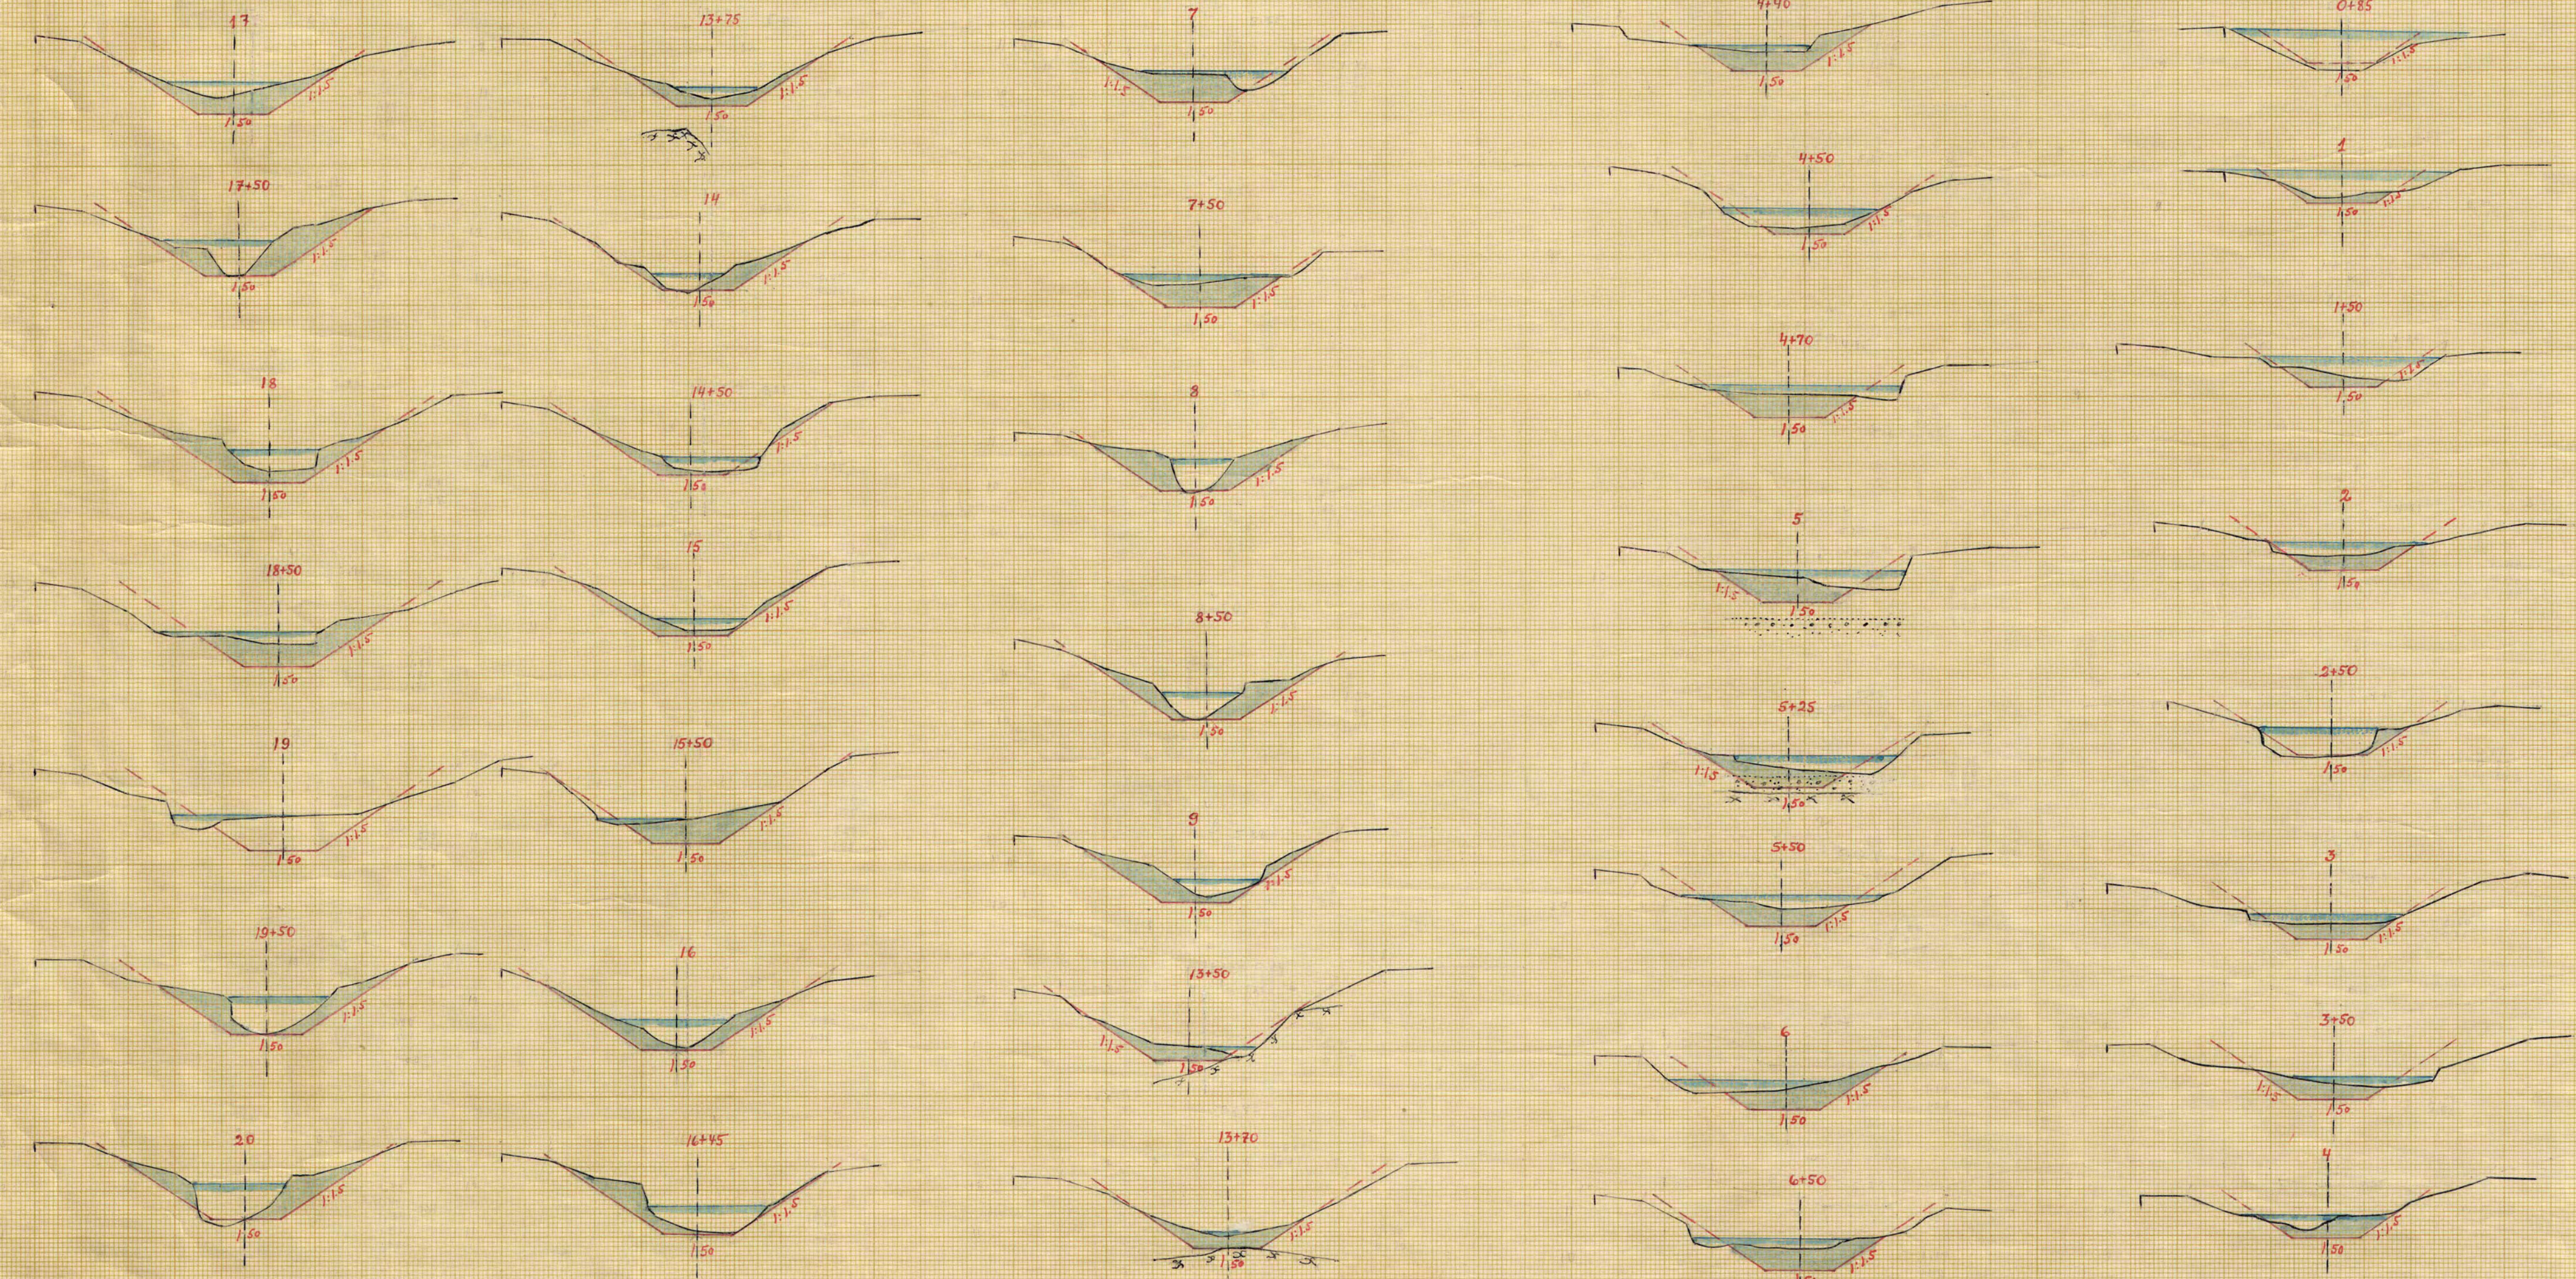

FÖRSLAG TILL utförande av torrlägningsföretaget

Örboholm-Yttervik

1 Västerviks SÖCKEN AV Södermanlands LÄN

UPPRÄTTAT ÅR 1948 (LÄN) SAMBAND MED SVNEFÖRÄTTNING ENL. VÄTTERLAGEN AV

ORIGINAL RITNINGEN 5*0428 Statens konbruksingenjör

ANTAL RITN. SK. 5 KUNGL. LANTBRUKSSTYRELSENS ARKIV Nr 2698-3